

Porsche Carrera Cup France 2026

Note Technique 07/2026

Chers tous,

Veuillez trouver ci-dessous la note technique 07/2026 applicable à votre Porsche 992 GT3 Cup.

Nous restons à votre disposition si vous avez des questions.

POSITIONNEMENT DE L'ACCELEROMETRE ABS

Sur les véhicules équipés d'un ABS, Porsche Motorsport vous informe que le mauvais positionnement de l'accéléromètre peut conduire à un fonctionnement anormal de ce système ABS.

DANGER !

MAUVAISE INSTALLATION DE L'ACCELEROMETRE

Conduite rendue instable due à un défaut de performance ABS

- Avant toute prochaine utilisation du véhicule, vérifiez que l'accéléromètre est installé dans la bonne position.

L'accéléromètre est monté sur le tunnel central. Durant l'installation, il est primordial de s'assurer que la flèche indiquant le **FOV (Front Of Vehicle)** sur le dessus du capteur, pointe bien vers l'avant du véhicule.

Une mauvaise installation peut conduire à une interprétation erronée de l'accélération du véhicule et peut perturber fortement le fonctionnement du système ABS. Dans ce cas, les pressions de frein ne seront également plus visibles dans les datas ou sur l'écran de bord.



Liste des pièces

Rep	Référence	Description	Qté
1	9F1906207	Accéléromètre ABS et TC	1

ABS ACCELEROMETER INSTALLATION POSITION

Porsche Motorsport informs that in vehicles equipped with ABS, incorrect installation of the accelerometer can cause the ABS to behave in an unintended manner.


WARNING!

INCORRECT INSTALLATION POSITION OF THE ACCELEROMETER
Unstable ride characteristics due to faulty ABS performance.

- Before the next operation of the vehicle, verify that the ABS accelerometer is installed in the correct position

The accelerometer is mounted on the center tunnel. During installation, it is essential to ensure that the arrow labeled “FOV” (Front of vehicle) on the top of the sensor points toward the front of the vehicle.

An incorrect installation position will result in inaccurate measurement of vehicle acceleration and may negatively affect the function of the ABS system. In this case, brake pressures will also no longer be displayed in the data or on the display.

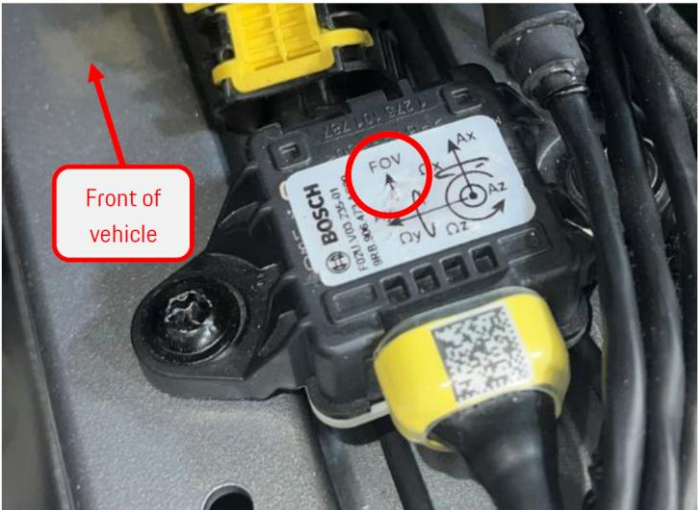

Parts list

Pos	Part number	Description	Qty
1	9F1906207	G-sensor ABS and TC	1